

Composite Thermal Barrier

This example shows how to set up multiple sandwiched thin layers with different thermal conductivities in two different ways.

First, the composite is modeled as a 3D object. In the second approach, the Thin Layer boundary condition is used to avoid resolving the thin domains, and two modeling options of this feature are compared.

The technique is useful when modeling heat transfer through thermal barriers like multilayer coatings.

See Lumped Composite Thermal Barrier for a comparison of the 3D approach with a 0D approach using the Lumped Thermal System interface.

Model Definition

This tutorial uses a simple geometry as shown in Figure 1. The cylinder has a radius of 2 cm and a height of 4 cm.

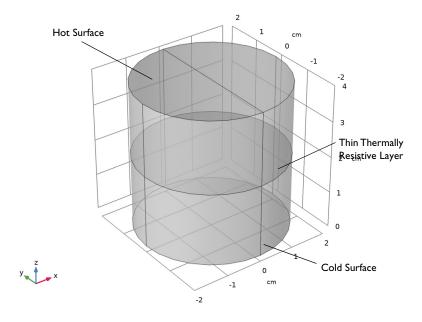


Figure 1: Geometry.

The composite consists of two layers with different thermal conductivities. The first approach resolves each layer as a 3D domain. The height of the layers is about three orders of magnitude smaller than the bulk height. This often requires to build a mesh manually to accurately resolve the thin structure.

COMSOL Multiphysics provides a special boundary condition which is available from the Heat Transfer Module, namely the Thin Layer feature.

The second approach first uses this feature with resistive property (Thermally thick approximation option). This simplifies the geometry and thus the mesh by representing the thermal barrier as a boundary. In complex geometries, this boundary condition can reduce the amount of memory and time required for the simulation significantly.

The underlying equation assumes the heat flux through the layer proportional to the temperature difference between upper and lower bulk. It is based on the assumption that the bulk on each side is well stirred so that all resistance against heat transfer is within a thin layer near the wall. Due to the additivity of resistance the flux over the composite can be lumped to

$$\begin{split} -\mathbf{n}_{\mathrm{d}}(-k_{\mathrm{d}}\nabla T_{\mathrm{d}}) &= \frac{k_{\mathrm{tot}}}{d_{\mathrm{tot}}}(T_{\mathrm{u}} - T_{\mathrm{d}}) \\ -\mathbf{n}_{\mathrm{u}}(-k_{\mathrm{u}}\nabla T_{\mathrm{u}}) &= \frac{k_{\mathrm{tot}}}{d_{\mathrm{tot}}}(T_{\mathrm{d}} - T_{\mathrm{u}}) \end{split}$$

where the overall thermal conductivity $k_{
m tot}$ can be calculated as

$$k_{\text{tot}} = \frac{\sum_{n} d_{n}}{\sum_{n} \frac{d_{n}}{k_{n}}}$$

Then, the second approach uses the General option of the Thin Layer feature. In this case, an extra-dimension is defined on the boundary to resolve the heat flux both in tangential and normal direction in the layers.

MATERIAL PROPERTIES

The cylinder is made of steel. The composite consists of two layers of different ceramics.

TABLE I: CERAMICS MATERIAL PROPERTIES.

PROPERTY	CERAMIC I	CERAMIC 2
Thermal conductivity	I W/(m·K)	0.5 W/(m·K)
Density	6000 kg/m ³	5800 kg/m ³
Heat capacity at constant pressure	320 J/(kg·K)	280 J/(kg·K)

BOUNDARY CONDITIONS

The temperature at the bottom is fixed to 20°C whereas one half of the top boundary is held at 1220°C (1493 K). All other outer boundaries are perfectly insulated.

Results and Discussion

Figure 2 shows the temperature distribution in the cylinder. The composite acts as a thermal barrier resulting in a jump of the temperature over the layer.

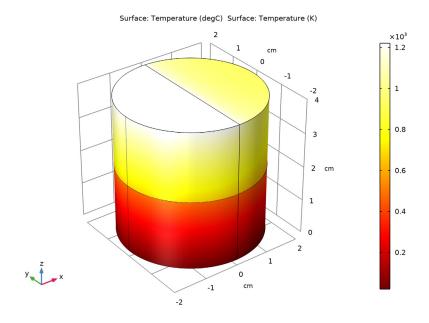


Figure 2: Temperature distribution.

Of interest is if the thin layer boundary condition produces reliable results compared to resolving the thin layers in 3D. This can be done with a comparative line graph as in Figure 3. It shows that the 2D approach, with or without a 1D extra dimension, produces accurate results for the bulk temperatures.

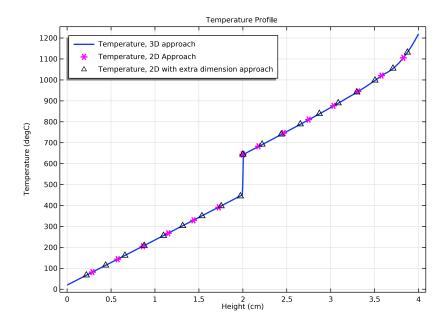


Figure 3: Temperature profile for 3D, 2D, and 2D with extra dimension approaches.

Another important question for simulating is the influence on the mesh size and on the required RAM.

With the default tetrahedral mesh the number of mesh elements is about 130,000 elements and the meshing algorithm gives some warnings.

With the swept mesh feature you can significantly reduce the number of elements to about 2,800 elements which is only 2%. In complex geometries the swept mesh algorithm is often not applicable. Using the thin layer boundary condition, the number of mesh elements reduces from 2,800 to 2,000 which is about 30% less, even in this simple geometry. You can see the number of mesh elements used in the Messages window below the Graphics window.

To compare the results directly, both approaches are handled within one mph-file.

Application Library path: Heat_Transfer_Module/Tutorials,_Thin_Structure/ composite_thermal_barrier

Modeling Instructions

From the File menu, choose New.

NEW

In the **New** window, click Model Wizard.

MODEL WIZARD

- I In the Model Wizard window, click **3D**.
- 2 In the Select Physics tree, select Heat Transfer>Heat Transfer in Solids (ht).
- 3 Click Add.
- 4 Click Study.
- 5 In the Select Study tree, select General Studies>Stationary.
- 6 Click M Done.

GLOBAL DEFINITIONS

Parameters 1

- I In the Model Builder window, under Global Definitions click Parameters I.
- 2 In the Settings window for Parameters, locate the Parameters section.
- **3** In the table, enter the following settings:

Name	Expression	Value	Description
d_ceram1	50[um]	5E-5 m	Thickness of layer 1
d_ceram2	75[um]	7.5E-5 m	Thickness of layer 2
T_hot	1220 [degC]	1493.2 K	Hot temperature

GEOMETRY I

I In the Model Builder window, under Component I (compl) click Geometry I.

- 2 In the Settings window for Geometry, locate the Units section.
- 3 From the Length unit list, choose cm.

Cylinder I (cyl1)

- I In the **Geometry** toolbar, click **Cylinder**.
- 2 In the Settings window for Cylinder, locate the Size and Shape section.
- 3 In the Radius text field, type 2.
- 4 In the **Height** text field, type 4.
- 5 In the Geometry toolbar, click **Build All**.

Now, create thin cylinders to define the ceramic layers between the two steel domains.

Cylinder 2 (cyl2)

- I In the Geometry toolbar, click Cylinder.
- 2 In the Settings window for Cylinder, locate the Size and Shape section.
- 3 In the Radius text field, type 2.
- 4 In the **Height** text field, type d_ceram1.
- 5 Locate the Position section. In the z text field, type 2-(d ceram1+d ceram2)/2.
- 6 In the Geometry toolbar, click **Build All**.

Cylinder 3 (cyl3)

- I In the **Geometry** toolbar, click **Cylinder**.
- 2 In the Settings window for Cylinder, locate the Size and Shape section.
- 3 In the Radius text field, type 2.
- 4 In the Height text field, type d ceram2.
- 5 Locate the Position section. In the z text field, type 2-(d_ceram1+d_ceram2)/2+ d ceram1.
- 6 In the Geometry toolbar, click **Build All**.

Polygon I (boll)

- I In the Geometry toolbar, click \bigoplus More Primitives and choose Polygon.
- 2 In the Settings window for Polygon, locate the Coordinates section.
- **3** In the table, enter the following settings:

x (cm)	y (cm)	z (cm)
0	-2	4
0	2	4

4 In the Geometry toolbar, click **Build All**.

DEFINITIONS

Create operators and variables to evaluate the average temperature in the thermal barrier and in each of its layers.

Integration: Barrier

- I In the Model Builder window, expand the Component I (compl)>Definitions node.
- 2 Right-click Definitions and choose Nonlocal Couplings>Integration.
- 3 In the Settings window for Integration, locate the Source Selection section.
- 4 Click Paste Selection.
- 5 In the Paste Selection dialog box, type 2 3 in the Selection text field.
- 6 Click OK.
- 7 In the Settings window for Integration, type intopBarrier in the Operator name text field.
- 8 In the Label text field, type Integration: Barrier.

Integration : Layer 1

- I Right-click Integration : Barrier and choose Duplicate.
- 2 In the Settings window for Integration, locate the Source Selection section.
- **3** In the list, select **3**.
- 4 Click Remove from Selection.
- **5** Select Domain 2 only.
- 6 In the Label text field, type Integration: Layer 1.
- 7 In the Operator name text field, type intopLayer1.

Integration: Layer 2

- I In the Model Builder window, under Component I (compl)>Definitions right-click Integration: Barrier (intopBarrier) and choose Duplicate.
- 2 In the Settings window for Integration, locate the Source Selection section.
- 3 In the list, select 2.
- 4 Click Remove from Selection.
- **5** Select Domain 3 only.
- 6 In the Label text field, type Integration: Layer 2.
- 7 In the Operator name text field, type intopLayer2.

Variables: temperature in thermal barrier

- I In the Model Builder window, right-click Definitions and choose Variables.
- 2 In the Settings window for Variables, locate the Variables section.
- **3** In the table, enter the following settings:

Name	Expression	Unit	Description
vol_barrier	intopBarrier(1)	m³	Volume of barrier
vol_layer1	intopLayer1(1)	m³	Volume of layer 1
vol_layer2	intopLayer2(1)	m³	Volume of layer 2
T_int_barrier	_int_barrier intopBarrier(T)		Integral of temperature in thermal barrier
T_int_layer1	intopLayer1(T)	m³·K	Integral of temperature in layer 1
T_int_layer2 intopLayer2(T)		m³·K	Integral of temperature in layer 2
T_ave_barrier intopBarrier(T)/ intopBarrier(1)		К	Average of temperature in thermal barrier
T_ave_layer1	<pre>intopLayer1(T)/ intopLayer1(1)</pre>	K	Average of temperature in layer 1
T_ave_layer2	<pre>intopLayer2(T)/ intopLayer2(1)</pre>	K	Average of temperature in layer 2

4 In the **Label** text field, type Variables: temperature in thermal barrier.

MATERIALS

Material Link I (matlnk I)

- I In the Model Builder window, under Component I (compl) right-click Materials and choose More Materials>Material Link.
- 2 In the Settings window for Material Link, locate the Link Settings section.
- 3 Click Add Material from Library.

ADD MATERIAL TO MATERIAL LINK I (MATLNKI)

- I Go to the Add Material to Material Link I (matInkI) window.
- 2 In the tree, select Built-in>Steel AISI 4340.
- 3 Click Add to Material Link I (matlnkl).

MATERIALS

Material Link 2 (matlnk2)

- I Right-click Materials and choose More Materials>Material Link.
- 2 In the Settings window for Material Link, locate the Geometric Entity Selection section.
- 3 Click Paste Selection.
- 4 In the Paste Selection dialog box, type 2 in the Selection text field.
- 5 Click OK.
- 6 In the Settings window for Material Link, locate the Link Settings section.
- 7 Click Blank Material.
- 8 In the Model Builder window, click Material Link 2 (matlnk2).
- 9 Click To Go to Material.

GLOBAL DEFINITIONS

Ceramic I

- I In the Model Builder window, under Global Definitions>Materials click Material 2 (mat2).
- 2 In the Settings window for Material, type Ceramic 1 in the Label text field.
- **3** Locate the **Material Contents** section. In the table, enter the following settings:

Property	Variable	Value	Unit	Property group
Thermal conductivity	k_iso ; kii = k_iso, kij = 0	1	W/(m·K)	Basic
Density	rho	6000	kg/m³	Basic
Heat capacity at constant pressure	Ср	320	J/(kg·K)	Basic

MATERIALS

Material Link 3 (matlnk3)

I In the Model Builder window, under Component I (compl) right-click Materials and choose More Materials>Material Link.

- 2 In the Settings window for Material Link, locate the Geometric Entity Selection section.
- 3 Click Paste Selection.
- 4 In the Paste Selection dialog box, type 3 in the Selection text field.
- 5 Click OK.
- 6 In the Settings window for Material Link, locate the Link Settings section.
- 7 Click Blank Material.
- 8 In the Model Builder window, click Material Link 3 (matlnk3).
- 9 Click To Go to Material.

GLOBAL DEFINITIONS

Ceramic 2

- I In the Model Builder window, under Global Definitions>Materials click Material 3 (mat3).
- 2 In the Settings window for Material, type Ceramic 2 in the Label text field.
- **3** Locate the **Material Contents** section. In the table, enter the following settings:

Property	Variable	Value	Unit	Property group
Thermal conductivity	k_iso ; kii = k_iso, kij = 0	0.5	W/(m·K)	Basic
Density	rho	5800	kg/m³	Basic
Heat capacity at constant pressure	Ср	280	J/(kg·K)	Basic

HEAT TRANSFER IN SOLIDS (HT)

Temperature I

- I In the Model Builder window, under Component I (compl) right-click Heat Transfer in Solids (ht) and choose Temperature.
- 2 Select Boundary 3 only.

Temperature 2

- I In the Physics toolbar, click **Boundaries** and choose **Temperature**.
- 2 Select Boundary 13 only.
- 3 In the Settings window for Temperature, locate the Temperature section.
- **4** In the T_0 text field, type T_hot.

MESH I

First, mesh the top surface with a free triangular mesh and extrude it in layers through the cylindrical geometry. With a **Distribution** node, specify how many mesh layers are to be created within the domain. Resolve the composite layers with two elements in thickness.

Free Triangular I

- I In the Mesh toolbar, click A Boundary and choose Free Triangular.
- 2 Select Boundaries 13 and 18 only.
- 3 In the Settings window for Free Triangular, click **Build Selected**.

Swept I

In the Mesh toolbar, click A Swept.

Distribution 1

- I Right-click Swept I and choose Distribution.
- **2** Select Domains 2 and 3 only.
- 3 In the Settings window for Distribution, locate the Distribution section.
- 4 In the Number of elements text field, type 2.
- 5 Click **Build All**.

STUDY I

In the **Home** toolbar, click **Compute**.

RESULTS

Temperature (ht)

The following plots are produced by default: temperature profile on the surface as in Figure 2, and isothermal contours.

Surface

- I In the Model Builder window, expand the Temperature (ht) node, then click Surface.
- 2 In the Settings window for Surface, locate the Expression section.
- 3 From the Unit list, choose degC.
- 4 In the Temperature (ht) toolbar, click **Plot**.

Next, create a temperature profile along the height of the cylinder. You will later compare the graph with the results of the 2D approach.

Temperature Profile

I In the Home toolbar, click <a>I Add Plot Group and choose ID Plot Group.

- 2 In the Settings window for ID Plot Group, type Temperature Profile in the Label text field.
- 3 Locate the **Plot Settings** section. Select the **x-axis label** check box.
- 4 In the associated text field, type Height (cm).
- 5 Click to expand the Title section. From the Title type list, choose Manual.
- 6 In the Title text area, type Temperature Profile.
- 7 Locate the Legend section. From the Position list, choose Upper left.

Line Graph 1

- I In the Temperature Profile toolbar, click \(\sum_{\text{Line Graph.}} \)
- **2** Select Edges 15, 17, 19, and 21 only.
- 3 In the Settings window for Line Graph, locate the y-Axis Data section.
- 4 From the **Unit** list, choose **degC**.
- 5 Locate the x-Axis Data section. From the Parameter list, choose Expression.
- **6** In the **Expression** text field, type z.
- 7 Click to expand the Coloring and Style section. In the Width text field, type 2.
- **8** Click to expand the **Legends** section. Select the **Show legends** check box.
- 9 From the Legends list, choose Manual.
- **10** In the table, enter the following settings:

Legends Temperature, 3D approach

II In the Temperature Profile toolbar, click **Plot**.

Group the plots corresponding to the 3D approach under a single node.

3D Abbroach

- I In the Model Builder window, right-click Results and choose Node Group.
- 2 In the Settings window for Group, type 3D Approach in the Label text field.

Isothermal Contours (ht)

Now let all the plots being regenerated after solving.

- I In the Model Builder window, click Results.
- 2 In the Settings window for Results, locate the Update of Results section.
- 3 Select the Recompute all plot data after solving check box.

Create now the second model which uses the **Thin Layer** feature and compare the results to the first approach.

ADD COMPONENT

In the Model Builder window, right-click the root node and choose Add Component>3D.

ADD PHYSICS

- I In the Home toolbar, click Add Physics to open the Add Physics window.
- 2 Go to the Add Physics window.
- 3 In the tree, select Heat Transfer>Heat Transfer in Solids (ht).
- 4 Find the Physics interfaces in study subsection. In the table, clear the Solve check box for Study I.
- 5 Click Add to Component 2 in the window toolbar.
- 6 In the Home toolbar, click Add Physics to close the Add Physics window.

ADD STUDY

- I In the Home toolbar, click Add Study to open the Add Study window.
- 2 Go to the Add Study window.
- 3 Find the Studies subsection. In the Select Study tree, select General Studies>Stationary.
- 4 Find the Physics interfaces in study subsection. In the table, clear the Solve check box for Heat Transfer in Solids (ht).
- 5 Click Add Study in the window toolbar.
- 6 In the Model Builder window, click the root node.
- 7 In the Home toolbar, click Add Study to close the Add Study window.

GEOMETRY 2

- I In the Settings window for Geometry, locate the Units section.
- **2** From the **Length unit** list, choose **cm**.

Cylinder I (cyl1)

- 1 Right-click Component 2 (comp2)>Geometry 2 and choose Cylinder.
- 2 In the Settings window for Cylinder, locate the Size and Shape section.
- 3 In the Radius text field, type 2.
- 4 In the Height text field, type 4.

5 Click to expand the **Layers** section. In the table, enter the following settings:

Layer name	Thickness (cm)
Layer 1	2

- 6 Clear the Layers on side check box.
- 7 Select the Layers on bottom check box.
- 8 In the Geometry toolbar, click **Build All**.

Polygon I (poll)

- I In the Geometry toolbar, click \bigcirc More Primitives and choose Polygon.
- 2 In the Settings window for Polygon, locate the Coordinates section.
- **3** In the table, enter the following settings:

x (cm)	y (cm)	z (cm)
0	-2	4
0	2	4

4 In the Geometry toolbar, click Build All.

DEFINITIONS (COMP2)

In order to make the comparison with **Component 1**, create an **Integration** operator and variables to evaluate the average temperature in the thermal barrier and in each of its layers.

Integration: Boundary

- I In the Model Builder window, expand the Component 2 (comp2)>Definitions node.
- 2 Right-click Component 2 (comp2)>Definitions and choose Nonlocal Couplings> Integration.
- 3 In the Settings window for Integration, type Integration: Boundary in the Label text field.
- 4 In the Operator name text field, type intopBnd.
- 5 Locate the Source Selection section. From the Geometric entity level list, choose Boundary.
- 6 Click Paste Selection.
- 7 In the Paste Selection dialog box, type 6 in the Selection text field.
- 8 Click OK.

Variables: temperature in thermal barrier

- I Right-click **Definitions** and choose **Variables**.
- 2 In the Settings window for Variables, locate the Variables section.
- **3** In the table, enter the following settings:

Name	Expression	Unit	Description
isLayer1	<pre>llmat1_xdim.atonly(dom==1)</pre>		Layer 1 identifier (=1 in layer 1, 0 elsewhere)
isLayer2	<pre>llmat1_xdim.atonly(dom==2)</pre>		Layer 2 identifier (=1 in layer 2, 0 elsewhere)
vol_barrier	<pre>intopBnd(ht2.sls2.xdintopall (1))</pre>		Volume of thermal barrier
vol_layer1	<pre>intopBnd(ht2.sls2.xdintopall (isLayer1))</pre>		Volume of layer 1
vol_layer2	<pre>intopBnd(ht2.sls2.xdintopall (isLayer2))</pre>		Volume of layer 2
T_int_barrier	<pre>intopBnd(ht2.sls2.xdintopall (T2))</pre>		Integral of temperature in thermal barrier
T_int_layer1	<pre>intopBnd(ht2.sls2.xdintopall (T2*isLayer1))</pre>		Integral of temperature in layer 1
T_int_layer2	_int_layer2 intopBnd(ht2.sls2.xdintopall (T2*isLayer2))		Integral of temperature in layer 2
T_ave_barrier T_int_barrier/vol_barrier			Average of temperature in thermal barrier
T_ave_layer1	T_int_layer1/vol_layer1		Average of temperature in layer 1
T_ave_layer2	T_int_layer2/vol_layer2		Average of temperature in layer 2

4 In the Label text field, type Variables: temperature in thermal barrier.

MATERIALS

Material Link 4 (matlnk4)

In the Model Builder window, under Component 2 (comp2) right-click Materials and choose More Materials>Material Link.

GLOBAL DEFINITIONS

Layered Material I (Imat I)

- I In the Model Builder window, under Global Definitions right-click Materials and choose Layered Material.
- 2 In the Settings window for Layered Material, locate the Layer Definition section.
- **3** In the table, enter the following settings:

Layer	Material	Rotation (deg)	Thickness	Mesh elements
Layer 1	Ceramic I (mat2)	0.0	d_ceram1	2

- 4 Click + Add.
- **5** In the table, enter the following settings:

Layer	Material	Rotation (deg)	Thickness	Mesh elements
Layer 2	Ceramic 2 (mat3)	0.0	d_ceram2	2

MATERIALS

Layered Material Link 1 (Ilmat I)

- I In the Model Builder window, under Component 2 (comp2) right-click Materials and choose Layers>Layered Material Link.
- 2 Select Boundary 6 only.

HEAT TRANSFER IN SOLIDS 2 (HT2)

Add two Thin Layer nodes on the same boundary. They will be activated each in two separated studies, to compare the **Thermally thick approximation** and **General** options.

I In the Model Builder window, under Component 2 (comp2) click Heat Transfer in Solids 2 (ht2).

Thin Layer I

I In the Physics toolbar, click **Boundaries** and choose Thin Layer.

2 Select Boundary 6 only.

Thin Layer 2

- I In the Physics toolbar, click **Boundaries** and choose Thin Layer.
- 2 Select Boundary 6 only.
- 3 In the Settings window for Thin Layer, locate the Layer Model section.
- 4 From the Layer type list, choose General.

Temperature I

- I In the Physics toolbar, click **Boundaries** and choose **Temperature**.
- 2 Select Boundary 3 only.

Temperature 2

- I In the Physics toolbar, click **Boundaries** and choose **Temperature**.
- **2** Select Boundary 7 only.
- 3 In the Settings window for Temperature, locate the Temperature section.
- **4** In the T_0 text field, type T_hot.

STUDY 2

Step 1: Stationary

- I In the Model Builder window, under Study 2 click Step 1: Stationary.
- 2 In the Settings window for Stationary, locate the Physics and Variables Selection section.
- 3 Select the Modify model configuration for study step check box.

Disable Thin Layer 2 in this study. First, Thin Layer 1 is used to show the results with the Thermally thick approximation option. Later, another study will use Thin Layer 2 with the General option.

- 4 In the Physics and variables selection tree, select Component 2 (comp2)> Heat Transfer in Solids 2 (ht2)>Thin Layer 2.
- 5 Click O Disable.

MESH 2

In the Model Builder window, under Component 2 (comp2) click Mesh 2.

Free Triangular I

- I In the Mesh toolbar, click A Boundary and choose Free Triangular.
- 2 Select Boundaries 7 and 10 only.
- 3 In the Settings window for Free Triangular, click | Build Selected.

Swebt I

- I In the Mesh toolbar, click A Swept.
- 2 In the Model Builder window, right-click Mesh 2 and choose Build All.

STUDY 2

In the **Home** toolbar, click **Compute**.

RESULTS

Surface I

- I In the Model Builder window, expand the Temperature (ht2) node, then click Surface I.
- 2 In the Settings window for Surface, locate the Expression section.
- 3 From the Unit list, choose degC.

Temperature Profile

In the Model Builder window, click Temperature Profile.

Line Graph 2

- I Right-click Temperature Profile and choose Line Graph.
- 2 In the Settings window for Line Graph, locate the Data section.
- 3 From the Dataset list, choose Study 2/Solution 2 (3) (sol2).
- 4 Select Edges 9 and 11 only.
- 5 Click Replace Expression in the upper-right corner of the y-Axis Data section. From the menu, choose Component 2 (comp2)>Heat Transfer in Solids 2>Temperature>T2 -Temperature - K.
- 6 Locate the y-Axis Data section. From the Unit list, choose degC.
- 7 Locate the x-Axis Data section. From the Parameter list, choose Expression.
- **8** In the **Expression** text field, type z.
- 9 Locate the Coloring and Style section. Find the Line style subsection. From the Line list, choose None.
- 10 From the Color list, choose Magenta.
- II Find the Line markers subsection. From the Marker list, choose Cycle.
- **12** In the **Number** text field, type 15.
- 13 Locate the Legends section. Select the Show legends check box.
- 14 From the Legends list, choose Manual.

15 In the table, enter the following settings:

Legends Temperature, 2D Approach

16 In the **Temperature Profile** toolbar, click **Plot**.

Surface 2

- I In the Model Builder window, click Surface 2.
- 2 In the Settings window for Surface, locate the Expression section.
- **3** From the **Unit** list, choose **degC**.

Group the plots corresponding to the 2D approach under a single node.

2D Approach

- I In the Model Builder window, right-click Results and choose Node Group.
- 2 In the Settings window for Group, type 2D Approach in the Label text field.

Isothermal Contours (ht2)

Next, add a study to solve Component 2 with Thin Layer 2 instead of Thin Layer 1. The Thin Layer 2 feature would use the General option which creates a 1D extra dimension formed by two intervals to represent the two ceramic layers.

ADD STUDY

- I In the Home toolbar, click Add Study to open the Add Study window.
- 2 Go to the Add Study window.
- 3 Find the Studies subsection. In the Select Study tree, select General Studies>Stationary.
- 4 Find the **Physics interfaces in study** subsection. In the table, clear the **Solve** check box for Heat Transfer in Solids (ht).
- 5 Click Add Study in the window toolbar.
- 6 In the Home toolbar, click Add Study to close the Add Study window.

STUDY 3

Steb 1: Stationary

- I In the Settings window for Stationary, locate the Physics and Variables Selection section.
- 2 Select the Modify model configuration for study step check box.
- 3 In the Physics and variables selection tree, select Component 2 (comp2)> Heat Transfer in Solids 2 (ht2)>Thin Layer I.

- 4 Click Disable.
- 5 In the Home toolbar, click **Compute**.

RESULTS

Surface I

- I In the Model Builder window, expand the Temperature (ht2) I node, then click Surface I.
- 2 In the Settings window for Surface, locate the Expression section.
- 3 From the Unit list, choose degC.

Surface 2

- I In the Model Builder window, click Surface 2.
- 2 In the Settings window for Surface, locate the Expression section.
- **3** From the **Unit** list, choose **degC**.

Temperature Profile

In the Model Builder window, click Temperature Profile.

Line Graph 3

- I In the Temperature Profile toolbar, click Line Graph.
- 2 In the Settings window for Line Graph, locate the Data section.
- 3 From the Dataset list, choose Study 3/Solution 3 (5) (sol3).
- **4** Select Edges 9 and 11 only.
- **5** Locate the **y-Axis Data** section. In the **Expression** text field, type T2.
- 6 From the Unit list, choose degC.
- 7 Locate the x-Axis Data section. From the Parameter list, choose Expression.
- 8 In the Expression text field, type z.
- 9 Locate the Coloring and Style section. Find the Line style subsection. From the Line list, choose None.
- 10 From the Color list, choose Black.
- II In the **Width** text field, type 2.
- 12 Find the Line markers subsection. From the Marker list, choose Triangle.
- 13 In the Number text field, type 20.
- 14 Locate the Legends section. Select the Show legends check box.
- 15 From the Legends list, choose Manual.

16 In the table, enter the following settings:

Legends

Temperature, 2D with extra dimension approach

17 In the Temperature Profile toolbar, click Plot.

The plot should look like that in Figure 3.

Group the plots corresponding to the 2D with extra dimension approach under a single node.

2D With Extra Dimension Approach

- I In the Model Builder window, right-click Results and choose Node Group.
- 2 In the Settings window for Group, type 2D With Extra Dimension Approach in the Label text field.

Isothermal Contours (ht2) I

Also, place the plot comparing the different approaches under a specific node.

Comparison of the Different Approaches

- I Right-click Results and choose Node Group.
- 2 In the Settings window for Group, type Comparison of the Different Approaches in the Label text field.

Temperature Profile

Next, create plots to compare more in details the results obtained with **Study I** and **Study** 3 for the temperature in the ceramic layers. In addition, evaluate the average of the thermal barrier temperature obtained with these two studies.

First, create a plot for the temperature solution at the surface of the thermal barrier.

Temperature (Layers Surface)

- I In the Home toolbar, click **Add Plot Group** and choose **3D Plot Group**.
- 2 In the Settings window for 3D Plot Group, type Temperature (Layers Surface) in the Label text field.
- 3 Locate the Data section. From the Dataset list, choose Layered Material 2.

Surface I

- I Right-click Temperature (Layers Surface) and choose Surface.
- 2 In the Settings window for Surface, locate the Expression section.
- 3 From the Unit list, choose degC.

- 4 Locate the Coloring and Style section. From the Color table list, choose ThermalLight.
- 5 In the Temperature (Layers Surface) toolbar, click **Plot**.

For a better rendering, change the scaling factor for the thickness of the layers in the **Layered Material 2** dataset.

Layered Material 2

- I In the Model Builder window, expand the Results>Datasets node, then click Layered Material 2.
- 2 In the Settings window for Layered Material, locate the Layers section.
- 3 In the Scale text field, type 20.
- 4 Click Plot.

Temperature (Layers Surface)

- I In the Model Builder window, click Temperature (Layers Surface).
- 2 In the Settings window for 3D Plot Group, locate the Plot Settings section.
- **3** From the **View** list, choose **New view**.

2D With Extra Dimension Approach

Next, create a plot for the temperature on slices of the thermal barrier.

Temberature (Slices)

- I In the Home toolbar, click **Add Plot Group** and choose **3D Plot Group**.
- 2 In the Settings window for 3D Plot Group, type Temperature (Slices) in the Label text field.
- 3 Locate the Data section. From the Dataset list, choose Study 3/Solution 3 (5) (sol3).
- **4** Locate the **Plot Settings** section. Clear the **Plot dataset edges** check box.
- 5 From the View list, choose New view.

Layered Material Slice 1

- I Right-click Temperature (Slices) and choose Layered Material Slice.
- 2 In the Settings window for Layered Material Slice, locate the Expression section.
- 3 From the Unit list, choose degC.
- 4 Locate the Through-Thickness Location section. From the Location definition list, choose Interfaces.
- **5** Locate the **Layout** section. From the **Displacement** list, choose **Linear**.
- **6** From the **Orientation** list, choose **x**.

- 7 In the Relative x-separation text field, type 0.25.
- 8 Select the **Show descriptions** check box.
- **9** In the **Relative separation** text field, type 1.
- 10 Locate the Coloring and Style section. From the Color table list, choose ThermalLight.
- II In the Temperature (Slices) toolbar, click **Plot**.
- 12 Click the **Zoom Extents** button in the **Graphics** toolbar.

Next, plot the temperature through the thickness of the thermal barrier.

Temperature (Through Thickness)

- I In the Home toolbar, click **Add Plot Group** and choose ID Plot Group.
- 2 In the Settings window for ID Plot Group, type Temperature (Through Thickness) in the Label text field.

Line Graph 1

- I Right-click Temperature (Through Thickness) and choose Line Graph.
- **2** Select Edges 4 and 7 only.
- 3 In the Settings window for Line Graph, locate the y-Axis Data section.
- 4 In the Expression text field, type z-(2[cm]-(d ceram1+d ceram2)/2).
- 5 From the **Unit** list, choose **m**.
- 6 Locate the x-Axis Data section. From the Parameter list, choose Expression.
- 7 From the Unit list, choose degC.

Temperature (Through Thickness)

In the Model Builder window, click Temperature (Through Thickness).

Through Thickness I

- I In the Temperature (Through Thickness) toolbar, click \to More Plots and choose Through Thickness.
- 2 In the Settings window for Through Thickness, locate the Data section.
- 3 From the Dataset list, choose Study 3/Solution 3 (5) (sol3).
- **4** Select Point 2 only.
- **5** Locate the **x-Axis Data** section. In the **Expression** text field, type T2.
- 6 From the Unit list, choose degC.
- 7 Click to expand the Coloring and Style section. Find the Line style subsection. From the Line list, choose None.

- 8 Find the Line markers subsection. From the Marker list, choose Cycle.
- 9 Locate the y-Axis Data section. Find the Interface positions subsection. From the Show interface positions list, choose All interfaces.

Temperature (Through Thickness)

Finally, evaluate the average temperature in the thermal barrier and in each of its layers by making a **Global Evaluation** of the variables defined previously in each component.

Global Evaluation 1

- I In the Results toolbar, click (8.5) Global Evaluation.
- 2 In the Settings window for Global Evaluation, click Replace Expression in the upper-right corner of the Expressions section. From the menu, choose Component I (compl)> Definitions>Variables>T_ave_barrier - Average of temperature in thermal barrier - K.
- 3 Click Add Expression in the upper-right corner of the Expressions section. From the menu, choose Component I (compl)>Definitions>Variables>T_ave_layerI -Average of temperature in layer I - K.
- 4 Click Add Expression in the upper-right corner of the Expressions section. From the menu, choose Component I (compl)>Definitions>Variables>T_ave_layer2 -Average of temperature in layer 2 - K.
- **5** Locate the **Expressions** section. In the table, enter the following settings:

Expression	Unit	Description
T_ave_barrier	degC	Average of temperature in thermal barrier
T_ave_layer1	degC	Average of temperature in layer 1
T_ave_layer2	degC	Average of temperature in layer 2

6 Click **= Evaluate**.

Global Evaluation 2

- I In the Results toolbar, click (8.5) Global Evaluation.
- 2 In the Settings window for Global Evaluation, locate the Data section.
- 3 From the Dataset list, choose Study 3/Solution 3 (5) (sol3).
- 4 Click Replace Expression in the upper-right corner of the Expressions section. From the menu, choose Component 2 (comp2)>Definitions>Variables>T_ave_barrier -Average of temperature in thermal barrier - K.

- 5 Click Add Expression in the upper-right corner of the Expressions section. From the menu, choose Component 2 (comp2)>Definitions>Variables>T_ave_layerI -Average of temperature in layer I - K.
- 6 Click Add Expression in the upper-right corner of the Expressions section. From the menu, choose Component 2 (comp2)>Definitions>Variables>T_ave_layer2 -Average of temperature in layer 2 - K.
- 7 Locate the Expressions section. In the table, enter the following settings:

Expression	Unit	Description
T_ave_barrier	degC	Average of temperature in thermal barrier
T_ave_layer1	degC	Average of temperature in layer 1
T_ave_layer2	degC	Average of temperature in layer 2

8 Click **= Evaluate**.

The average temperature is close to 530°C in the thermal barrier, with some noticeable difference between the two layers.